
DI5YQ-02

DTC P1641/89 Communication Malfunction No.2

CIRCUIT DESCRIPTION

DTC No.	Detection Item	Trouble Area
P1640/89	When fail output of ECU communication is fixed ON or OFF for	•Wire harness
	88 msec. at opposite ECU.	• Engine ECU

WIRING DIAGRAM

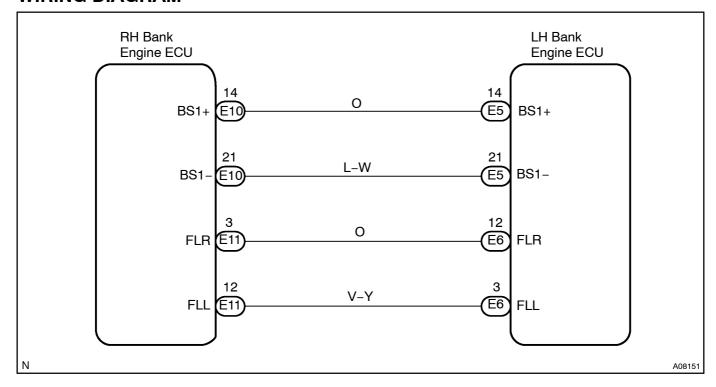

INSPECTION PROCEDURE

1 Check for open and short in harness and connector between each terminals FLL of LH bank engine ECU and FLR of RH bank engine ECU (See page IN-20).

NG Repair or replace harness or connector.

OK

Check and replace opposite bank engine ECU when that ECU detects P1641/89.