

SYMBOLS

The following symbols are used in the Welding Diagrams in Section RE of this manual to indicate cutting areas and the types of weld required.


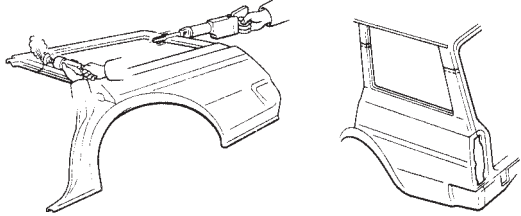

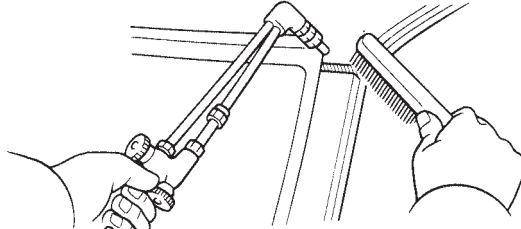
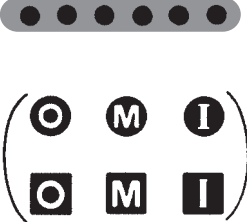
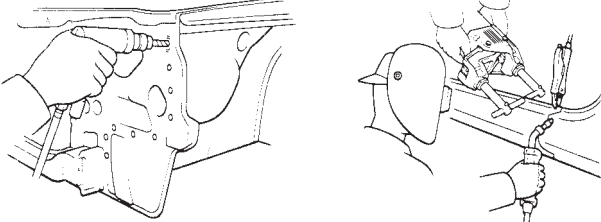

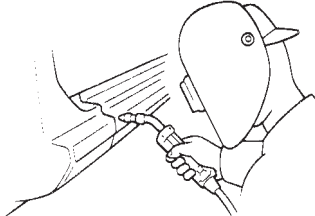

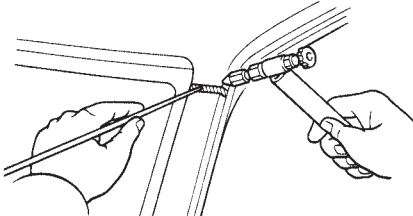

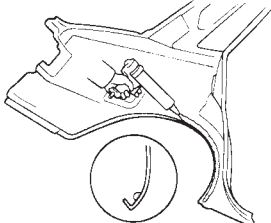
SYMBOLS	MEANING	ILLUSTRATION
	<p>SAW CUT OR ROUGH CUT</p>	
	<p>REMOVE BRAZE</p>	
	<p>WELD POINTS SPOT WELD OR MIG PLUG WELD <i>(See page IN-5)</i></p>	
	<p>CONTINUOUS MIG WELD (BUTT WELD OR TACK WELD)</p>	
	<p>BRAZE</p>	
	<p>BODY SEALER</p>	

Illustration of Weld Point Symbols

EXAMPLE:

REMOVAL	INSTALLATION
<p>Remove weld point and panel position</p>	<p>Weld method and panel position</p>

SYMBOL	MEANING	ILLUSTRATION	SYMBOL	MEANING	ILLUSTRATION
 	Remove Weld Points		 	Spot Weld	
	(Outside)		 	Mig Plug Weld	
	(Middle)		 	Spot MIG Weld	
	(Inside)				
<p><i>HINT: Panel position symbols are as seen from the working posture.</i></p>					