

2. Messages are not indicated correctly.


INSPECTION PROCEDURE

1 Indicator check.

CHECK:

Speedometer, tachometer, ambient temperature, clock*, multi-information display, ODO/TRIP

- Partial omission of characters.
- Abnormal indication.
- Non lighting of part of indicators.

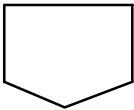

2 Check of connector connection.

CHECK:

Is connection of each meter computer connector correct and firm?

Connect to be checked:

Speedometer – connector I

Multi-information display and tachometer – connector G

Ambient temperature and clock* – connector F

ODO/TRIP – connector H

Yes

Poor connector connection.

No

Faulty meter ECU.

*: For vehicle with electronic multi-vision.